

DART SERVICE INSTRUCTION

To further protect Dart crosstubes from mechanical damage in service, they may be treated with "Armor Shield" surface treatment. To designate crosstubes with 'Armor Shield' add 'A' to the Part Number. For example, D206-667-101A is a D206-667-101 crosstube coated with Armor Shield. The Change Number of Dart crosstubes with "Armor Shield" is affected as per above table. It is acceptable to apply the Armor Shield in regions shown in Figure 1 or Figure 2 only. It is **NOT** acceptable to apply Armor Shield in the cuff and support/clamp regions.

INSTALLATION	STC		CHANGE NUMBER	
	CANADIAN	FAA	DSI 9326 REV. A (Proform PF746/746-1 Treatment)	DSI 9326 REV. B (BCG4 Treatment)
D205-596-101A/-103A/-105/-107A	SH03-6 ISSUE 3	SR01742NY	CHG 001	CHG 002 (or later)
D212-664-101A/-201A D412-664-203A D412-664-105A/-205A	SH01-9 ISSUE 3	SR01298NY	CHG 002 (or earlier) CHG 004 (or earlier) N/A	CHG 003 (or later) CHG 005 (or later) CHG 001 (or later)
D206-667-101A/-103A/-201A/-203A D407-667-105A/-205A	SH01-5 ISSUE 3	SR01304NY	CHG 001 CHG 002 (or earlier)	CHG 002 (or later) CHG 003 (or later)
D058-676-101A/-201A	N/A	SR01018SE	CHG 001	CHG 002 (or later)
D350-748-101A/-201A	SH06-27 ISSUE 1	SR02359NY	N/A	CHG 001 (or later)

1.0 TO APPLY ARMOR SHIELD

- 1.1 Ensure the crosstube is appropriately finished in accordance with the relevant manufacturing drawing or Instruction for Continued Airworthiness (ICA).
- 1.2 Clean/degrease surface of crosstube using Methyl Ethyl Ketone (MEK), 4105S Wash'n'Wipe Degreaser, or equivalent and wipe the surface to clean the entire area
- 1.3 Mask areas around supports and cuffs per Figure 1 or Figure 2 (D350-748-101/-201 only). Abrade paint finish in areas requiring protection using 800 grit sandpaper. Ensure the surface is de-glossed.
- 1.4 Re-clean the surface per Step 1.2.
- 1.5 Mix BCG4 Component A and BCG4 Component B in accordance with manufacturer's instructions.
- 1.6 Apply 5 wet coats in accordance with manufacturer's instructions.
- 1.7 To avoid hard tape line, unmask immediately after application of last coat.
- 1.8 Allow BCG4 to dry in accordance with manufacturer's instructions.

2.0 ARMOR SHIELD REMOVAL / RE-APPLICATION

To remove the Armor Shield coating or if damage to the coating and/or crosstube is observed during inspection.

- 2.1 Remove Armor Shield from the affected area using 80 grit sandpaper. To remove Armor Shield from larger areas, bead blasting has been determined to be the most effective technique.
- 2.2 Repair mechanical damage (within limits) to the crosstube and touch up finish in accordance with the relevant ICA.
- 2.3 Apply Armor Shield in accordance with Section 1.0 of these instructions.

CANADA DEPARTMENT OF TRANSPORT AIRCRAFT CERTIFICATION BRANCH DAO # 01-O-01
APPROVED  BY: <u>D. SHEPHERD (DE # 02)</u>
DATE: <u>07.10.17</u> CERT. NO.: <u>SEE TABLE</u> ISSUE NO.: <u>SEE TABLE</u>

B	BCG4 REPLACES DISCONTINUED PROFORM PF 746 OR PF 746-1; ADD D350-748-101/-201	MB	07.10.17
A	NEW ISSUE	PH	06.02.14
REV.	DESCRIPTION	BY	DATE
DESIGN	<u>PH</u>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	<u>PH</u>		
CHECKED	<u>PH</u>		
MFG. APPR.	<u>PH</u>		
APPROVED	<u>PH</u>		
DE APPR.	<u>PH</u>	DRAWING NO. REV. B DSI 9326 SHEET 1 OF 2	
DATE 07.10.17		TITLE SCALE ARMOR SHIELD NTS	
COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

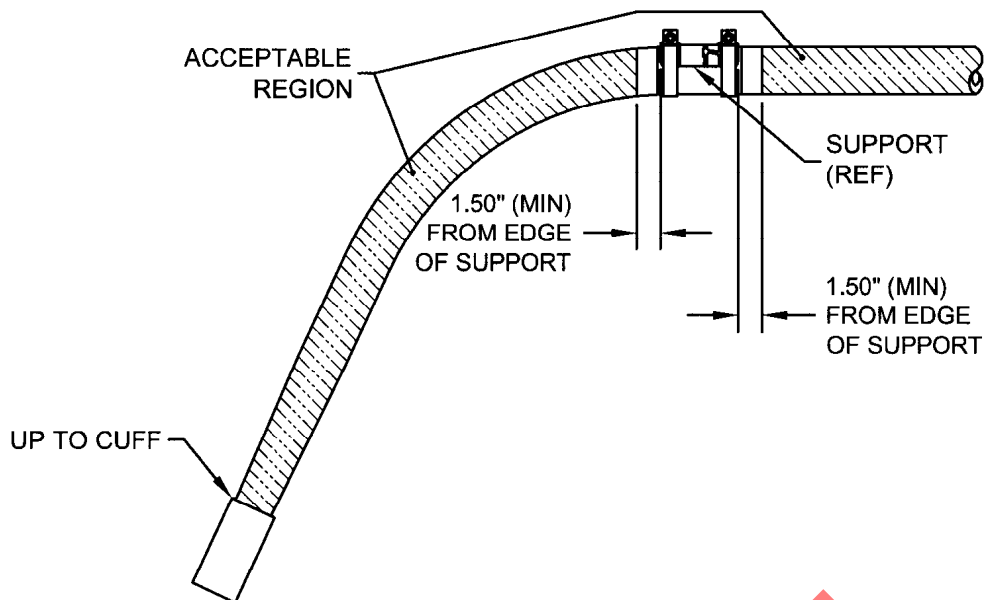


FIGURE 1 - ACCEPTABLE REGIONS TO BE COATED WITH ARMOR SHIELD
(SEE FIGURE 2 FOR D350-748-101/-201 CROSSTUBES)

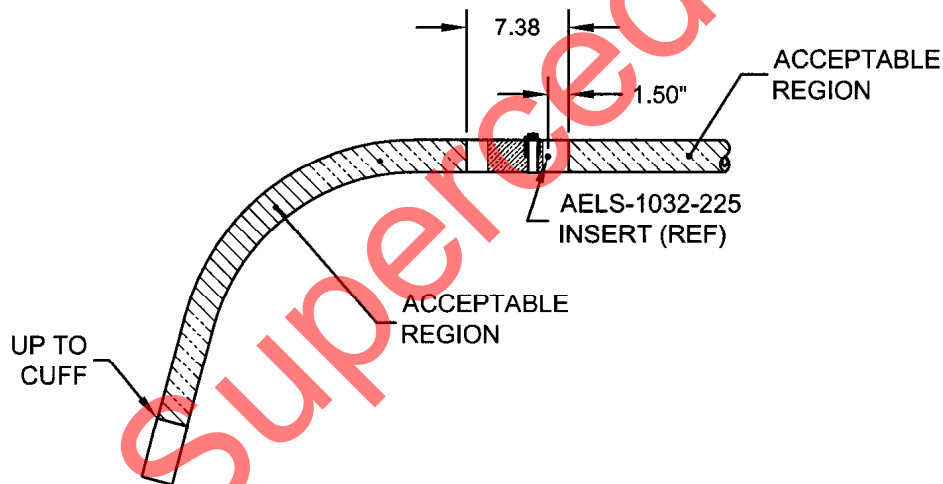


FIGURE 2 - ACCEPTABLE REGIONS TO BE COATED WITH ARMOR SHIELD
(D350-748-101/-201 ONLY)

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED
BY: *[Signature]*
D. SHEPHERD (DE # 02)
DATE: 07.10.17
CERT. NO.: SEE TABLE
ISSUE NO.: SEE TABLE

DESIGN	<i>PH</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	<i>PH</i>		
CHECKED	<i>PH</i>	DRAWING NO.	REV. B
MFG. APPR.	<i>PH</i>	DSI 9326	SHEET 2 OF 2
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	ARMOR SHIELD	NTS
DATE	07.10.17	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	